



TECHNICAL BULLETIN

YAMAHA ELECTRONICS CORP., USA

6660 Orangethorpe Avenue, Buena Park, CA 90620-1345 (714) 522-9105

Number: **235H**

Effective Date: **November 14, 2002**

MODELS AFFECTED: **RX-V1**

SERIAL NUMBERS AFFECTED: **ALL**

FUNCTIONS AFFECTED: **SPEAKER OUTPUT**

TYPE OF CHANGE

MANDATORY



OPTIONAL



FOR INFO. ONLY



(Only in response to a customer complaint)

SYMPTOM: Intermittent weak output or distortion from one or more speaker channels. Inserting and removing an RCA plug into the Pre Out or Main In jack for the suspected channel may temporarily restore normal output.

CAUSE: Poor electrical connection at the internal switch contact inside the Pre Out and/or Main In jacks.

SOLUTION: Replace the Video (4) PCB or ALL of the jacks listed in the table below, even if only one jack is defective. (PJ907 for the subwoofer does not apply.)

Part Number	Description	Ref. Number
RXV1VIDEOPCB	Video (4) PCB	(Return for core credit)
V4548500	Pin Jack (Red/White)	PJ905, 906, 910, 911
V4806700	Pin Jack (Black)	PJ908, 909

