Thermocouple logger

Plugging into a pc's printer port, Pei An's thermocouple-based temperature logger gives you six channels each capable of measurements in the range ~270°C to 1370°C. Measurement resolution is 19 bits.

his article describes a low-cost six-channel temperature data logger using thermocouples. The device connects to the printer port of a pc via a standard printer cable. Six K-type thermocouples can be connected to the device using industry standard thermocouple connectors.

With the right thermocouples, temperatures in the range -270°C to 1370°C can be measured. Figure 1 shows the complete system.

Thermocouple principles

When the junction of two dissimilar metals is heated, an c.m.f. is generated. This is known as the Seebeck effect and the junction is called a thermocouple.

Junctions are formed by twisting the ends of two wires together and then welding them. The basic operation of a thermocouple is shown in Fig. 2. The sensing junction – i.e. the hot junction – is at the temperature to be measured. The reference junction, which is the cold junction, is held at a reference temperature.

Resulting emf is proportional to the difference between the

temperatures of the two junctions. The second of the emf depends on the composition of the two wires.

There is a family of industrial standard thermocouples and they are identified by types, Fig. 2. One uniperature range, composition and standard code for temperature measurement using

Type K thermocouple is published whilely used, it is suitable for temperature; ran 4270°C to + 1370°C. Its positive arm is 15% nickel balanced by Al, Si and Mn - an alloy known as Alumel. The second is an alloy known as chromel which confice and 10% chrome.

Type K thermocouples have the of accuracy:


Class 1: range: -40°C 10 +1000°C

accuracy: ±0.004T or ±1.5°C Class 2: range: -40°C to +1200°C

accuracy: ±0.00757 or ±2.5°C

Class 3: range: -200°C to +100°C
accuracy: ±0.0157 or ±2.5°C

cen the accuracy: ±0.0151 o

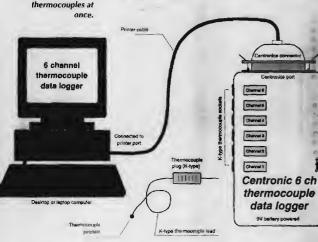



Since the logger is based on cross devices, it can be implemented compactly and operated from a 9V battery.

Fig. 1. Linking to the

the data logger takes

readings of up to six

pc via its LPT port,

The larger of the two deviation values should be chosen. Value T is the temperature measured by the thermocouple.

Figure 3 illustrates the emf values as a function of temperature in degrees celsial for various types of thermocouples. The output is reasonably linear over a wide temperature range. But above a certain temperature, the emf falls off. Knowing the emf, you can find the temperature using a polynomial.

$$T = A_0 + A_1 X + A_2 X^2 + A_3 X^3 ... + A_n X^n$$

in which T is the temperature in degrees celsius, X is the thermocouple output voltage in volts, A_{0-n} are polynomial coefficients which are unique to each type of thermocouple and n is the order of the polynomial. The relationship between the e.m.f. verms temperature can be found in the 1EG584 international thermocouple reference tables.

Thermocouple wires can be as small as 50µm in diameter—
or even less. As a result, thermocouple junctions can be
made very small, especially if a butt joint is used. Due to the
low mass lawolved, and thermocouples can have fast
response times of a few elliseconds. They are also cheap
and have a wide operating temperature range.

Ladvarial thermocouples come in different forms. They

Industrial thermocouples come in different forms. They have to be chosen to suit the individual application.

A classical way to measure temperature using thermocou-


ples is shown in Fig. 42. The sensing junction is at the temperature to be measured. The reference junction is placed at a reference temperature.

One way of providing the reference temperature is to use an insulated both committing water and ice. This will give a temperature exactly at 0°C. The emf is proportional to the temperature difference between the junctions and is measured by a volumeter.

The emf from multiple thermocouples can be measured using methods shown in Figures 4b and 4c. Such methods are especially useful for multi-channel thermocouple mea-

These methods sequire the temperature of the connection terminals to be known. This can be done using a reference themporeuple connected to one of terminals, as in Fig. 4b), or using a second mached to the terminals for mea-

Continued I for listing

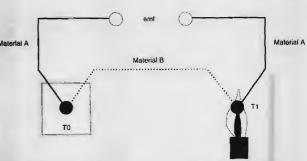

T0: reference temperature

T1: temperature to be measured

Thermocouple types	Materials		
E	chromei vs constantan		
J	iron vs constantan		
к	chromel vs alumel		
R	platinum vs platinum+13% rhodium		
S	platinum vs platinum+10% rhodium		
Т	copper vs constantan		

Fig. 2. In a conventional thermocouple sensing arrangement, emf produced is proportional to the difference between two thermocouple junctions one at a reference temperature, the other at the temperature to be determined.


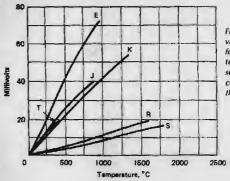


Fig. 3. EMF variations as a function of temperature for a selection of commonly used thermocauples.

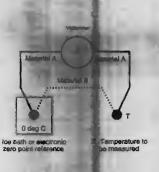


erminals of a multi-channel data Ø Ø Ø Ø 0 TO

Terminals arranged so that they

are at a similar temperature

0°C External ice bath or electronic zero point raference

(b) multi-channel measurement (using an external temperature reference)

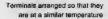

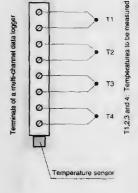


Fig. 4. In practice, there are several different ways of configuring the thermocouple circuit.

(c) multi-channel measurement (using an on-board temperature sensor)

```
Program thermocouple_logger;
( 6 channel temperature logger using thermocouples
  Hardware and software developed by Dr Pei An, 1/98*)
{DATA PORT: DB0-CLK, DB1-A0, DB2-CONV, DB3-CAL, DB4-ADD0; DB5-ADD1, DB6-ADD2 DB7-ADD3
             ADD1 to ADD3 connected to A0, A2 and A3 on multiplexer
STATUS FORT DB6-READY, DB7-DATA IN )
( A0=0 selects expanded analogue input channel
  A0=1 selects on-board analogue multiplexer )
( address=0 for batter voltage monitoring
   address=1 for on-board temperature sensor, 10mV/deg C
   address=2-7 for voltages inputs (6 off) )
uses
   Crt. dos:
Var
   ch.command, i:byte;
   Datax:array[1..30] of byte;
   P_address, dummy; integer;
Function bitweight (bit:byte):real;
  pl,i:longint;
begin
   P1 -= 1 -
   if bit=1 then bitweight:=1
         else begin
              for i:=1 to bit-1 do P1:=P1*2;
              bitweight:=p1;
              end:
end;
     -Detect LPT base addresses---*)
Procedure Centronics_address;
 (* $000:$0408 holds the printer base address for LPT1
   $000:$040A holds the printer base address for LPT2
$000:$040C holds the printer base address for LPT3
   $000:$040e holds the printer base address for LPT4
   $000:$0411 number of parallel interfaces in binary format*)
   lpt:array[1..4] of integer;
   number_of_lpt.LPT_number.code:integer;
   kbchar:char:
begin
   clrscr;
   LPT_number:=1;
                                      (*to set default printer*)
   number_of_lpt:=mem($8000:$0411);
                                      (*to read number of installed Centronics ports*)
    number_of_lpt:=(number_of_lpt and (128+64)) shr 6;
                                                              (*Bit manipulation*)
                                     (*Memory read procedure*)
    lpt[1]:=memw[$0000:$0408];
    lpt[2]:-memw[$0000:$040A]:
   lpt[3]:=memw[$0000:$040C];
lpt[4]:=memw[$0000:$040E];
    textbackground(blue); clrscr;
    textcolor(yellow); textbackground(red); window(10,22,70,24); clrser;
    writeln('Number of LPT installed
                                                         ', number_of_lpt:2);
    writeln('Number of LPT installed : ',nu
writeln('Addresses for LPT1 to LPT 4: ',lpt[1];3,'
                                                                  ', lpt[2]:3,
                                                                                       lpt(3):3,
 lpt[4]:3);
    write('Select LPT to be used (1,2,3,4) :
                                                        .);
    delay(1000):
    if number of lpt>1 then begin
                            (select LPT1 through LPT4 if more than 1 LPT installed)
          kbchar:=readkey;
                                              (*read input key*)
          val(kbchar, LPT_number, code);
                                               (*change character to value*)
          until (LPT_number>=1) and (LPT_number<=4) and (lpt[LFT_number]<>0)
                        end:
    clrser;
    P_address:=lpt[LPT_number];
    writeln('Your selected printer interface:
                                                        LPT', LPT_number:1);
    write('LPT
                   Address
                                                         ', P_address:3);
    delay(1000);
    textbackground(black); window(1,1,80,25); clrscr;
 end:
 ( --- read duta from STATUS port of pc-
 Function Read_status_port(P_address:integer):byte;
 var
   byte1:byte;
  begin
    bytel:=port[P_address+1];
                                      (*read a byte from the status port*)
    byte1:=byte1 and (120+128);
                        (*11111000 (MSB to LSB) and Odddd... = Odddd0000*)
   Read_status_port:=bytel shr 3;
                        (*shift 3 bit right, Read_status_port = 0000hhhh*)
 end;
 ( --- Write data to DATA port of pc-
 Procedure Write_data_port(P_address:integer; port_data:byte);
 (*no lines in the Data port are not inverted*)
 begin
    port[P_address]:=port_data;
                                     (*output a byte to the data port*)
```

```
end;
Function Input_data:byte
begin
  input_data: = read_status_port(P_address);
end;
Function CAD: longint;
(Calibrating the A/D conserter)
begin
  command: 40;
  port(P_address):=8.8+command: (CONV=0, CAL=1)
  delay(20);
  delay(2000);
end:
Function voltage (address; byte) : real;
(read voltage )
var
sum real;
  viarray [1..10] of real;
  i, ix: integer;
begin
  sum:=0:
  command: AAO*2+address*32;
Port[P_address]:=6+Command; {CONV=1, CAL=0}
repeat until (input_data and 8) = 0;
                     (-MEDY goes low to indicate a complete conversion)
  delay(1);
  for i1=1 to 10 do
       'begin
          datax[31-i]:=1-round((input_data and 16)/16);
                     (note: DB7 of the status port is inverted)
            port(F_address):=1+command;
(CLK goes from low to high to start shifting)
            port[P_sidron]:=command;
[CM goes from high to low to clock out next bit)
  for i.e. to 2d do begin sum:=sum+bitweight(i)*datax[i] end;
voltage=*[sum = 8*256*256) /8/256*256*2.500; (bipolar shifting)
port[P_address ==commod;
  delay(100) r
end:
Function TC( manulabyte) real;
(*read temperature from a channel, channel=1 to 6*)
var
  tempirella
begin
   temp:=(wellingu(1,1)/0.01 + (voltage(1,channel+1))/0.0000405);
  TC:=temp;
if (tempa=1500) then TC:=0;
   if (temper-180) them EC:=0;
Procedure Messure_all;
begin
  gotosy (10, 25); write(1
                                 Press any key to stop logging');
                             Data read from the data logger');
   gotoxy(10,1) ; write()
      gotoxy(21,101; write('Battery voltage :',voltage(1,0)*5.7:10:1,' [V]');
      gotomy(21,13); solte('On-board temp.:',voltage(1,1)/0.01:10:1.'
for last to 5
                                                                          [deg C] ');
      for land
                         м
      und:
                                          :',TC(i):10:1,' [deg C]');
   until be
and.
Procedure Diagrams
(A diagram showing the layout of the data logger)
begin
   window(1,1,80,35);
   Textbackground(blue)
   textcolor(yellow);
   clrscr;
   writela(' Layout of the 6 channel thermocouple data logger');
   writelm
   Features');
                                                                   6 K-type thermocouple sockets');
   writeln(*
                                                                   ß
  writelni
                                                                   ß
                                                                          19-bit A/D conversion accuracy');
                                 Channel 6
                                                                   ß
                                                                         Measurement range');
                                                                          -100 to 1350°C
   writeln(' 44 4 ' writeln(' - 4
                                Channel 5
                                                                         #2°C accuracy');
                                                                   B
                                                                         Centronics port connection');
   writels! esse
                                Channel 4
                                                                   R
                                                                         On-board temperature sensor');
   writeln(1
                                                                          A PP3 9V battery required');
```

PC INTERFACING

```
writeln('
                                    Channel 3
  writeln('
  writeIn!
                                    Chamnel 2
  writelne
  writelne
                                    Channel 1
  writeln(
  writeln(
  writeln('
  writeln(
  writeln('
                           Bijttitittittittitititititititittiti
   writeln('
  writeln('
  writeln(
                                                                Press any key to continue');
  write (
end;
Procedure manual:
began
   window(1,1,80,25);
   textbackground(blue):
   textcolor(yellow):
   clrscr;
   gotoxy(10,1); write("
                                     8 channel thermocouple data logger')
   gotoxy(10,2); wrlue(*
                                    Chose the number and pressed RETURN');
   gotoxy(20,10); write('[1]
                                    Disgram of the data logger');
   gotoxy(20,11): write('[3]
                                    Calibration');
   gotoxy(20,12); write('[)]
gotoxy(20,13); write('[4]
                                    Measure all' 1;
                                    Quit the session');
   textbackground(gleen);
   textcolor(white):
   window[1.25,80,25);
   clrser;
   gotoxy(1,10); write( Press [1] to (4)*);
   gotoxy180,251:
അർ.
Procedure manual selection:
var
   key_char.char:
begin
  manual:
repeat
   key_char:=readkey;
   if key_char='l' them begin
                       diagram;
                       repeat until keypressed:
                       read la:
                       marual:
                       end:
   if key_chars'3' them begin
                       window[1.1,80,25];
                       endemy:=CAD:
                       manual:
                       end:
   If key_char='J' then begin
                       window(1,1,80,25);
                       textbackground(blue);
                       textcolor(yellow);
                       cleser:
                       measure all:
                       maruual:
                       वाहार्थ :
   if key_char='4' then begin
                       halt
                       end:
until (key_char)='7';
delay(1004);
   clrscr:
end:
 (**** MAIN PROGRAM****)
begin
   Centronics_address. ('select a Centronics interface')
   Port[P_addreds];=0; (all lines of the DATA port are zero)
   command: #U;
   cluser:
   dummy: =cad;
   delay(10000);
   dummy:=cad;
   delay(10000);
   dummy: =round(voltage(1,0)),
   manual:
   manual_selection:
```

Software driver

ß

.);

٠);

1);

1);

ß

The software driver is written in Turbo | 6 List. 1. This program only demonstrates how the har we of the device is controlled by a software.

Battery low voltage warning'):

Temperature monitor ng');

Slim size');

Applications');

It shows how to calibrate the a-to-d rter and how to get a conversion data from the convert does not have functions to log data continuously and was the data into a

Here's an outline of what the functions and procedures do. The procedure,

Centronics_address

detects the number of Centronics ports alled on your computer and allows you to select while port to use. The function.

Read_status_port(P_address:integer)

reads data from the status port. The procedure,

Write_data_port(P_address:integor; ____data;byte)

outputs a data byte from the data port. function,

performs calibration of the a-to-d constant. The function,

voltage(address:byte)

controls the a-to-d converter and measures a voltage from an analogue channel specified by address. The function,

TC (channel: byte)

converts the voltage into a temperature value. Here the relationship between e.m.f. and temperature is treated as a linear one. Finally, the procedure,

Measure_all

measures temperatures from all six channels.

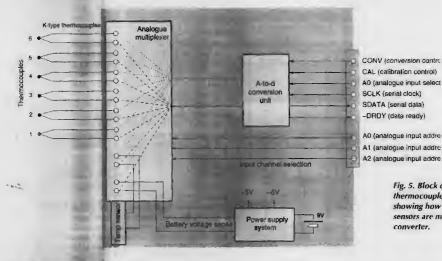


Fig. 5. Block diagram of the thermocouple measurement subsystem showing how readings from the six sensors are multiplexed into one a-to-d converter.

suring the temperature, Fig. 4c.

All the terminals should be kept at a similar temperature to minimise errors in the reference temperature. This can be done by mounting all the terminals on a piece of copper plate and keeping them away from heat sources.

Overview of the hardware

Figure 5 is a block diagram of the thermocouple data logger. The device consists of four units: the a-to-d conversion unit, the analogue multiplexer unit, the temperature sensing unit and the power supply unit.

The a-to-d convertion unit is based on a CS5504 20-bit ato-d converter. When it operates in bipolar mode and the voltage reference is 2.5V, it could measure an input voltage as small as ±5.45aV. Note that the K-type thermocouple gives 40aV/°C.

In order to measure six channels of thermocouple signals, the data logger uses a MAX337 analogue multiplexer. This device provides aight differential analogue inputs. Six of them are used for thermocouples. One is used for the on-hoard temperature sensor and one is used for monitoring the voltage of the battery.

The temperature sensing unit is based on an LM35DZ celsius temperature sensor. It measures the temperature of the terminals on the circuit board. This is the reference temperature for calculation temperatures measured by thermocouples.

The power supply unit comprises a low-power, low-voltage-drop +5V HT1050 voltage regulator and a 7660 voltage inverter to generate x-5V supply from the +5V power supply. The -5V power supply is used by the CS5504 and the MAX337.


The CS5504 a-to-d converter

For a-to-d conversion, I chose the dual-channel 20-bit CS5504. This device uses delta-sigma conversion and has serial i/o. It provides low-cost, high-resolution measurement at output word rates up to 200 samples per second.

Being a cmos device, the CS5504 draws less than a milliamp from the supply. It consists of a delta-sigma converter, a voltage reference, a calibration microcontroller, a static ram, a digital filter and a serial interface, Fig. 6.

The on-chip digital filter provides mains rejection at SOHz and 60Hz when the device is operated from a 32.768kHz crystal, which gives a 20Hz sampling rate. The on-chip self-calibration circuity ensures minimum offset and full-scale errors in a conversion.



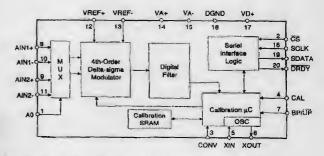


Three operating states are possible with the device: standby, calibration and conversion. Stand-by state is entered after the device has completed an operation and no command is given to it. After a power-on, a wake-up period comprising 1800 clock periods exists before the device enters the standby state.

Calibration must be performed before a valid conversion can be made. The calibration state is entered when CAL is high and CONV goes from low to high. During calibration, the device first performs an offset calibration and then a gain calibration. This is conducted by the on-board calibration micro-controller. Calibration takes 3246 clock cycles and the calibration coefficients are stored in the calibration static ram for use during conversion.

At the end of the calibration cycle, the microcontroller checks the logic state of the CONV signal. If it is low, the device enters the stand-by mode, waiting for further instruction. If it is high, the device performs conversion on one of

Fig. 6. At relatively low cost, the CS5504 cmos a-to-d converter provides 20-bit measurement resolution and has on-chip mains rejection filtering.

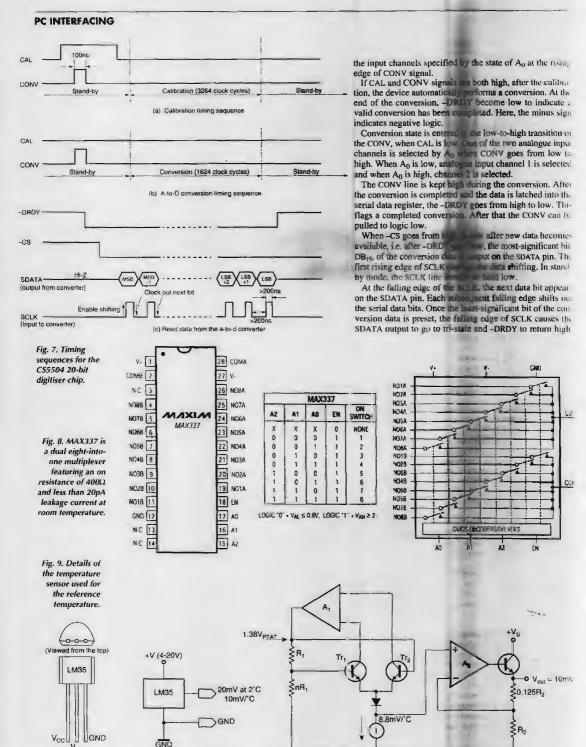

(a) Pin-out of LM35DZ (b) Temperature sensor based on LM35DZ

(c) Internal block diagram

Pln functions of the Centronics port connectors

Connector		Direction	Name	Explanation
computer	printer	Direction	Maine	LAPIBILIBION
1	1	CtoP	STROBE	Strobe data
2	2	C to P	DB0	Data bil 0
3	3	CtoP	DB1	Date bit 1
4	4	CtoP	DB2	Onta bit 2
5	5	CtoP	DB3	Data bit 3
6	6	CIOP	D84	Data bit 4
7	7	CtoP	DB5	Date bit 5
8	8	CtoP	DB6	Date bit 6
9	9	CtoP	DB7	Date bit 7
10	10	PIOC	ACK	indicating data received
11	11	PIOC	BUSY	Indicating printer busy
12	12	PtoC	PE.	Indicating paper ampty
13	13	PtoC	SLCT	Indicating printer on line
14	14	C to P	LF/CR	Auto linateed after carriage return
15	32	PloC	ERROR	Indicating printer arror
16	31	CtoP	INITIALISE	Initiaties printer
17	36	C to P	SLIN	Select/deselect printer
18-25	19-30			
	and 33		GND	Twiated-pair return ground
	18,34		Unused	
	16		Logic GND	Logic ground
	17		Chasis GND	Chasis ground

'C' = Computer 'P' = Printer



(a) Pin-out of the Centronics connector on po compatibles - viewed from the back of the po Connector type: 25-pin female D-type

38 17 16 15 14 13 12 11 10 8 8 7 6 5 4 3 2 1

(b) Placet of the Centronics connector on printers
- viewed from the back of the printer
Connector type: 35-pin female Centronics-type

Fig. 10. Functions of a standard pc's LPT port connections follow the long-established Centronics standard.


The Centronics printer port

Pin layout and functions of a pc's Centronics printer port is shown in Fig. 10.

Details of the port can be found in reference 3. In brief, a standard Centronics port contains three i/o ports. One port is the DATA port, comprising eight outputs, another is the CONTROL port which consists of four outputs and the third is the STATUS port which is made up of five inputs.

The DATA and CONTROL ports are output ports and the status port is an input. The computer uses these ports to output data and the STATUS port to input a five-bit word.

Table 1. Output coding for unipolar and bipolar modes. Unipolar mode **Output codes** Bipolar mode > Vrec-1.5 lsb FFFFF16 > V_{rof}-1.5 lsb Vref-1.5 isb FFFFF16 V_{ref}-1.5 lsb V_{ref}/2--0.5 lsb 80000₁₆-FFFFF₁₆ -0.5 lsb 0.5 lsb 0000116-0000016 -V_{ret}+0.5 lsb <0.5 lsb 0000016 < V_{rel}+0.5 lsb

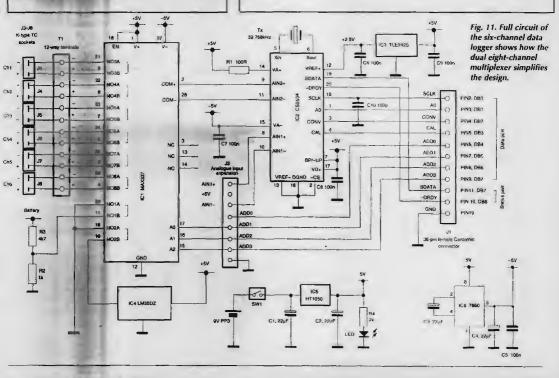

This indicates that the serial data register is emptied. Only under this condition can the serial port registers be updated with new data on completion of another conversion, Fig. 7.

The input signal can be configured for a unipolar or bipolar signal depending on the status of BP/-UP line. The CS5504 converter outputs data in a binary format when converting unipolar or in offset binary form when converting a bipolar signal. Table 1 shows the output coding for the two measurement modes.

More details on the CS5504 are available in the manufacturer's data sheet.¹

Eight-into-one multiplexing

The MAX337 is a dual eight-to-one cmos analogue multiplexer. It features a maximum on resistance of 400Ω and the device conducts current equally well in both directions. It has an extremely low off leakage – less than $20\mathrm{pA}$ at room temperature – and an on channel leakage figure of less than $50\mathrm{pA}$.

The device operates from a single supply of between ± 4.5 V and ± 30 V, or from a dual power supply of ± 4.5 V to ± 20 V. All control pins are ttl compatible.

Pin-out, pin functions and internal block diagram of the MAX337 are given in Fig. 8. The device contains two eight-to-one analogue multiplexers. One of the eight inputs is connected to the common output by control of a three-bit binary address, A₀₋₂.

In the present circuit, the two multiplexers are used together to provide differential multiplexed inputs. More details on the MAX337 can be found in the maker's data sheet.²

Temperature referencing

An LM35DZ is used as the on-board temperature sensor. Fig. 9. This is a precision temperature sensor whose output voil age is linearly proportional to the celsius temperature in a range from 0°C to 100°C. Without calibration, it is able to achieve an accuracy of 0.6°C at 25°C.

The sensitivity of the sensor is 10mV per degree celsius. The device requires a supply from +4V to 30V. Its quiescent current is only 56μA with a voltage supply of +5V. This makes the sensor ideal for battery operated applications. Low quiescent current also ensures that the self-heating of the device is below 0.08°C in still day.

Circuit detail

You will see from Fig. 11 that the DATA and the STATUS ports of the Centronics port are used for controlling the operations of the data logger and for reading data from it.

Lines in the DATA port are used as shown in Table 2. Two lines in the STATUS port are used for receiving data from the logger into the computer. Lines 103, are not used, DB₀ connects to the -DRDY line of the used converter and DB₇ connects to the SDATA line of the used converter. This line inverted.

Figure 12 shows how compact the system can be.

References

- 1. Data sheet CS5504, Crystal Semiconductor Corporation.
- 2. Data sheet MAX336/MAX337, Maxim Corporation.
- PC Interfacing Using Centronics, R5232 and game ports, Pei An, Newnes, Butterworth-Heinemann, 1998, ISBN0240514483.

Table 2. Summary of the functions of the printer port data pins.

DBO: serial clock SCLK for a-to-d conversion

DB1: analogue multiplexer selection line, Ao on a-to-d converter,

DB2: conversion line CONV on a-to-d converter

DB3: calibration line CAL on a-to-d converter

DB4: ADD0, not used

DB5: ADD1, connects to MAX337 pin An

DB6: ADD2, connects to MAX337 pin A1

DB7: ADD3, connects to MAX337 pin A2

Technical support

Designers' kits including all necessary components to construct a complete thermocouple data logger and the TP6 source codes are available from the author. Please make your enquiry to Dr Pei An, 11 Sandpiper Drive, Stockport, Manchester SK3 8UL, UK. Tel/fax/answer m/c +44-(0)161-477-9583, Pei's e-mail address is PAN@FS1.ENG.MAN.AC, UK.

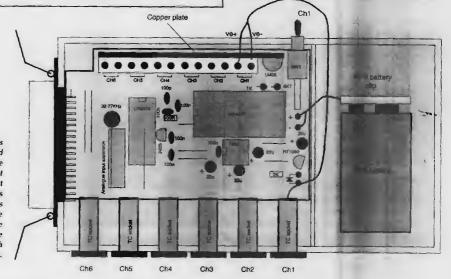


Fig. 12. Pei's self-contained thermocouple measurement subsystem is a compact design running from its own power source. As a reader service, the design is being made available from the author, together with its software.