

**SONY**

Hi-Fi Products  
Service Bulletin

Sony Service Company - Technical Services  
A Division of Sony Corporation of America  
Sony Drive, Park Ridge, New Jersey 07656

**Model:** STR-VX550

**No. 3**

**Subject:** Missing 1S1555 Diode

**Date:** January 28, 1988

**Symptom:**

(151)

Early production of STR-VX550 diode 1S1555 was omitted from the display board.

**Solution:**


When servicing STR-VX550, check if this diode is installed. If the diode is missing, solder a 1S1555 between collector of Q308 and base of Q305. The cathode should be connected to the collector of Q308.

Receiver

CSA-13

Add Diode 1S1555  
Part No. 8-719-815-55

DISPLAY BOARD

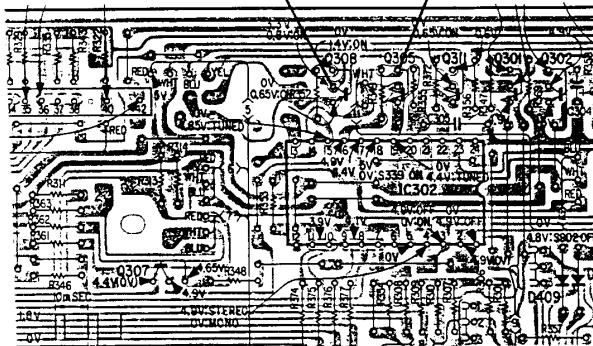

Reference:

PRINTED IN U.S.A.  
CSA-13288-1